



Service Info



Tensioner pulleys 531 0252 30 and 531 0525 30

Risk of mix-ups

Manufacturers: Seat, Škoda, VW

Models:

- Seat: Arosa, Cordoba, Ibiza II, Ibiza III, Ibiza IV, Inca
- Škoda: Felicia I, Felicia II, Octavia
- VW: Bora, Caddy II, Fox, Golf III, Lupo, Polo, Vento

Engines: 1.0, 1.0i, 1.3, 1.4, 1.4i, 1.6, 1.6i, 1.9 TDI

Part no.: 531 0252 30
531 0525 30

For current listing refer to catalogue media

With tensioner pulleys 531 0252 30 and 531 0525 30, there is a risk of mistaking one for the other.

Not only are our part numbers very similar, they also appear to be almost identical.

Only the indicator of the two tensioner pulleys and its arrangement are different (Fig. 1).

The number stamped on the back also helps to differentiate between them (Fig. 2):

article number	stamped number
532 0252 30	979272
532 0525 30	979548

Before installation, it is extremely important to verify the part number. The similarity of the numbers increases the risk of mix-ups.

Although they look very much the same, they are technically very different. Tensioner pulley 531 0252 30 has a higher tensioning force and a larger working range than tensioner pulley 531 0525 30.



Fig. 1: Left - tensioner pulley 531 0252 30, right - tensioner pulley 531 0525 30

Use of the wrong tensioner pulley can cause the toothed belt to flutter and jump teeth. Engine damage may occur as a result.



Fig. 2: Left - tensioner pulley 531 0252 30, right - tensioner pulley 531 0525 30

Please observe the vehicle manufacturer specifications!

You want more? We can help!
 Phone: +44 (0) 1432 264 264*
 Fax: +44 (0) 1432 375 760
 hfd-info@schaeffler.com
 www.schaeffler-aftermarket.co.uk
 * Calls from within the UK 08457 001100

Issued 01.2016 (replaced 03.2011) INA 0069 Technical content subject to change
 O.E. Manufacturer's names and numbers are used for reference purposes only
 © 2016 Schaeffler Automotive Aftermarket GmbH & Co. KG

